



1750   3250   5000	1, 10   1, 1
AUX   STAM   WISTA   DEB COLUTION   COLUTI	DESIGN PRESSURE (SN/RH) - 2975 FSIG/750 PSIG   WATTR COULD NOTE: (CIRCUM-LEGITAL)   194   SUPERITATE   (FROWN FRITAL)   194   WATTR COULD NOTE: (CIRCUM-LEGITAL)   194   WATTR COULD NOTE: (CIRCUM-LEGITAL)   194   WATTR COULD NOTE: (CIRCUM-LEGITAL)   194   WATTR COUNTY COUNTY CIRCUM-LEGITAL   194   WATTR COUNTY COUNTY CIRCUM-LEGITAL   194   WATTR COUNTY COUNTY CIRCUM-LEGITAL   194   WATTR COUNTY COUNT
10.0 CONDITION   2.2   2.3	
Net of the property of the p	17   19   19   19   19   19   19   19
	85.90   1   2   SUPTEMBRIE (PERPHERAL) 54" CENTERLINE 27, 24, 24, 26, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 24, 26, 26, 26, 26, 26, 26, 26, 26, 26, 26
	8049   10   10   10   10   10   10   10   1
Milit   PROFILED   MASANET   A   17, 3   56, 5	1.00   1   2   SUPERHEATER (FROJECTED)   4   367   302   302   303   3
101	13.00   1.00
1011   0.00   10   10   10   10   10	1003   11   11   11   11   11   11   1
1	10   10   10   10   10   10   10   10
	20   2   2   2   2   2   2   2   2   2
1	2640 11
1   1   1   1   1   1   1   1   1   1	28  28  29  29  20  20  20  20  20  20  20  20
	28   20   20   20   20   20   20   20
1	10   10   10   10   10   10   10   10
COA	182   23   10   10   10   10   10   10   10   1
T.COA   T.C.   DRUM   10 SN DULLIT   6A   73   1005   10	182   21   1   1   1   1   1   2   2   2
	1005   1007
100	1005   1007
1,56	100   10   17   17   18   18   18   18   18   18
1.	131, 600   131, 600
Carrier of Medica   Carrier   Carr	140   20   20   20   20   20   20   20
	140   24   24   24   24   24   24   24
	11/1294   10   10   10   10   10   10   10   1
	10   10   10   10   10   10   10   10
	11 010   ATT   12   11   11   11   12   ATT   12   11   11   11   12   ATT   13   ATT   13   ATT   14   ATT   15   ATT
TURNAGE ATER # # # # # # # # # # # # # # # # # # #	420/645 )
Continue   Constition states   2.2   1.9	3.1   3.4   1.5   4.3   MATINAN TOTAL MOISTURE SAGE REQUIRES 540   4.2
1.02   2.1   2.1   2.2   2.3	1.5   1.4   22% TOTAL MOISTURE GOAL REQUIRES 540   8.8   1.4   1.4   1.5   1.4   1.5   1
TOT HARD FURNACE   2,1   2,2   TOT AH OUTLET   5,2   5,2   5,2   5,2   5,0   2,0	231.02 131.031 1310.01.00 11.00 1310.01.00 11.00 1310.00 11.00 1310.
101   101   101   101   102   103	8.8 1.1 2.2 2.3 3.2 1.1 2.2 2.3 3.2 1.2 2.3 3.2 3.2 3.2 3.2 3.2 3.2 3.2 3.2 3
100   100	22 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3
100   101	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
DO	1310,1131 1310,1131
TOP	2 4 4 8 8 4 1 9 1 9 9 1 9 9 1 9 9 9 9 9 9 9 9 9 9
101, FRAT AN LINEA   1.8   2.2	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
OPT GAS   14   14   14   15   14   14   15   14   14	0.00 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
No.   1   No.	5.16
Particle	0.07
	0.07
Maderic Commonstrate   0.24   0.72	
MEDIATION   MEDIATION   0.24   0.124	7:0
HIGH CONTROL   1,000   1,140   1,100	1.50
	3
	200
NIT	O O O O O O O O O O O O O O O O O O O
FULL EFFICIENCY, 8, FOUTPUT/FULL IMPUT)   88   55   88.65	\$7 88
2/8	88,54
2/81 2 10131 PANIS, DR 40/108 WOLDS GUTPUT 76 72 75 2 1 1 1 10 0 015 U. WHAT I S. ASSULT OF CONTROL OF STATES OF STA	7 6 7
F. S. I IMBU (AD U.N.N. NITY) 71 76 72 75 75 PRIDICIO PER UNHABEL I. BALLO DA COMBUSTIVE ALR PRICEING UNIT	2.5
BASID ON CONBUSTION AIR INTERING UNIT	72 56
	,
ON 25, 18 in. M. BARMETHIC PRESSURE, UN CONCILIONS & EUGIPMENT GIVEN ON INIS SUPPLIED &	448T 3HL1 1

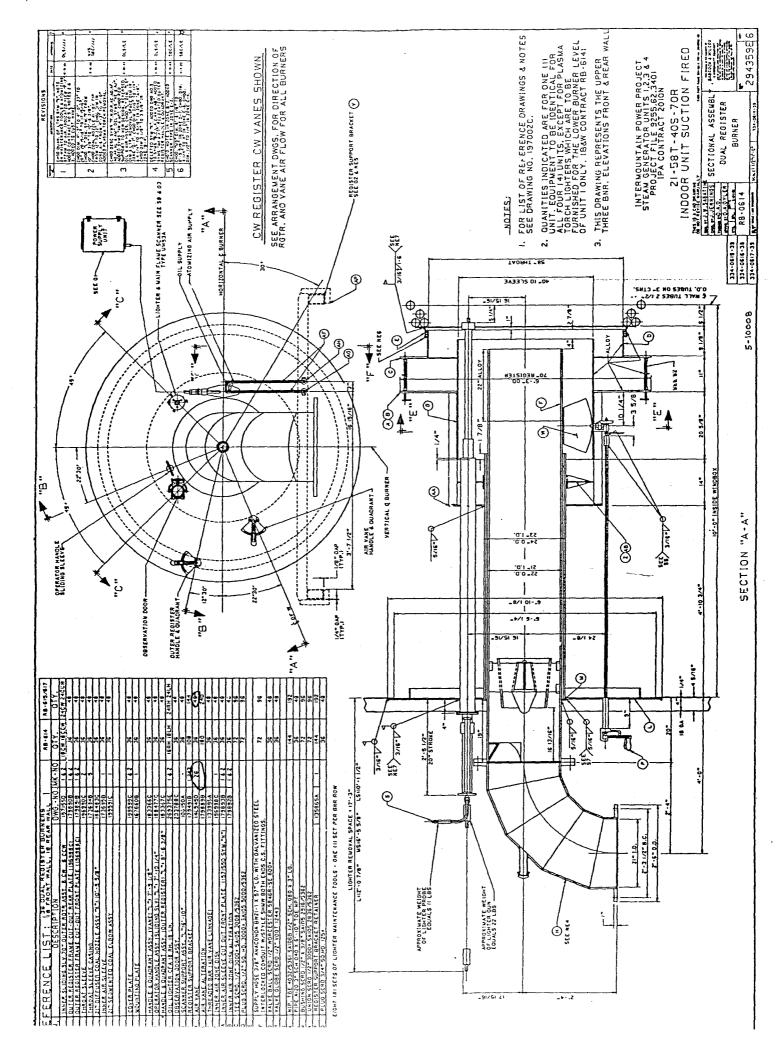

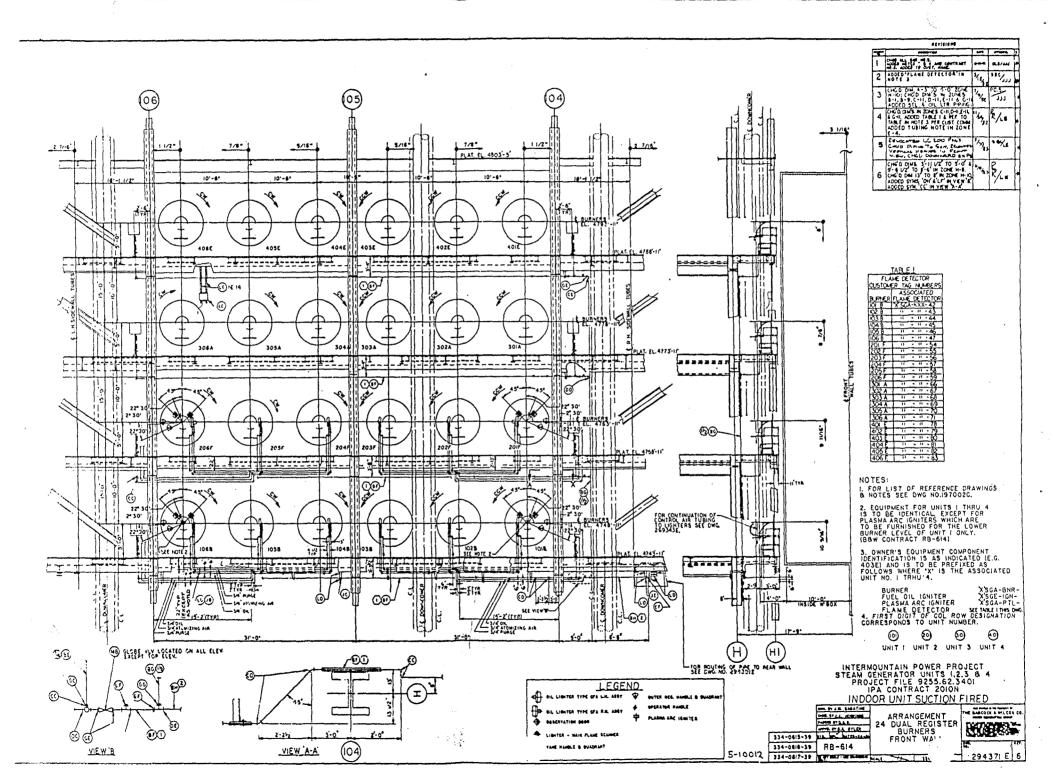

MT BY:


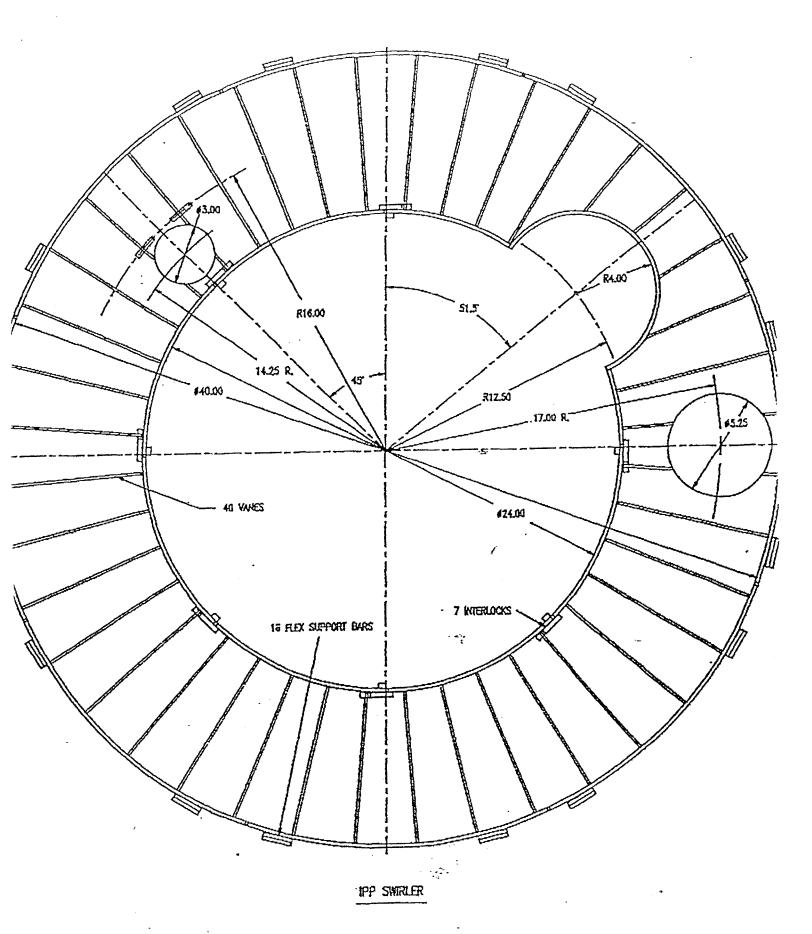


Figure 47 Intermountain Project Swirler Power



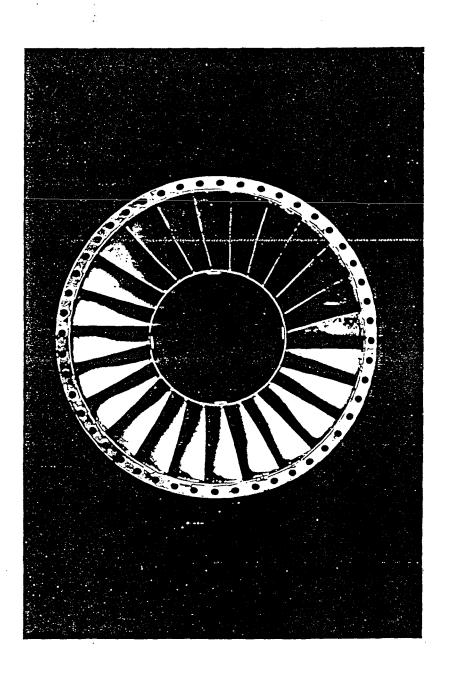

### **Correct Burner Flow Pattern**

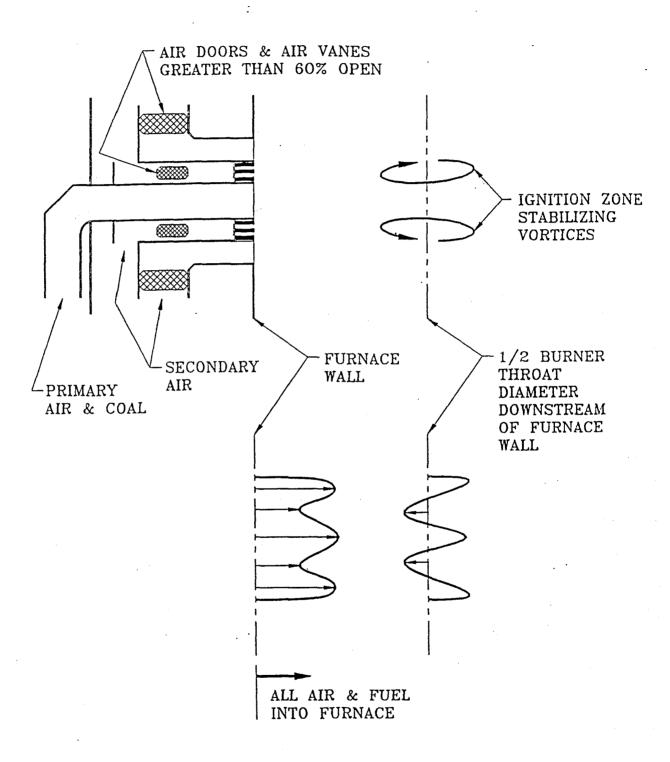


Figure 3

### Burner Swirl vs. Eyebrow Formation


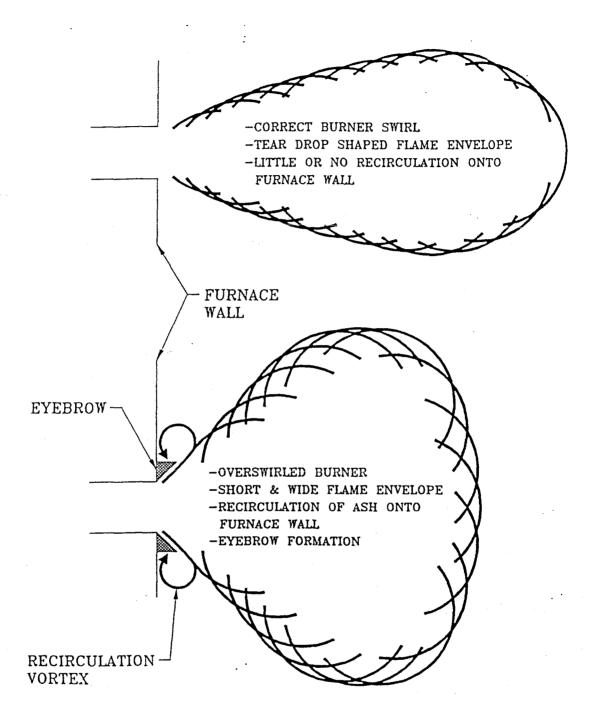


Figure 4

Engineering Test and Inspection Sheet


Sheet <u>1</u> of <u>5</u>

Equipment Burners and	d Windbox Unit # 2 Tes	st/Inspect. DateOct. 27-28, 1991
Inspector <u>Cecil James</u> Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations
1) Remove 7 inc 2) Remove 4 inc 3) Install an i 4) Install a sh	ons performed this outage to all Unit 2 burners include hes from the inner air sleeve tip hes from the lighter shroud nner air stabilizer provided by RJM Corporation roud around the outer air register cribed restrictors in selected burner lines	
Stabilizers were in Shrouds were instal	implemented to improve air distribution and aerodynamic stalled to mitigate furnace gases from licking back intended to balance the air flow from burner to burner, see umentation in the air flow balancing.	the burner throat area, see photos 1 - 3
determined using a changed out for rea were measured for c	diffusers, and deflectors were removed for the air flow go-no go gauge to assure nozzle conformance for the stal sons stemming from severe distortion, holes at the tip, omparison with measurements taken the fall, 1990 Unit 2 report. 37 of 48 diffusers had erosion holes in the topaced.	oilizer installation. Eleven nozzles were and weld seam cracking. All diffusers outage. Results from the comparisons are
deviations as high Restrictors were no recommended by B&W.	lines received new or modified restrictor spools. Prev as 11.2 percent. Restrictor change outs were performed made according to IPSC drawings. The restrictor exit Calculations found the pressure losses due to the abrancurred with a 30 degree bevel, so the restrictors were	to balance primary air within 5 percent. did not have a 30 degree bevel, as upt enlargement to be negligable as
a. Outer b. Spin c. Regis d. Burne e. Therm f. Windb	ection was conducted October 27 and 28, during which, to air registers Vanes/ Backplate ter drive linkages r casing seal occuples ox dampers er sight tubes	ne following items were examined:
The following infor diffuser strut (top	mation details burner defects and deficiencies found du and bottom) measurements, and restrictor modifications	ring inspections, diffuser inspection and performed on each respective burner line.
в1	3/4" hole in cone. Top: 1-7/8", Bottom: 5-3/4" Restrictor changed to 18" ID.	New diffuser 11/91
В2	Ceramic diffuser. Top: 8-3/4", Bottom: 8-3/4"	

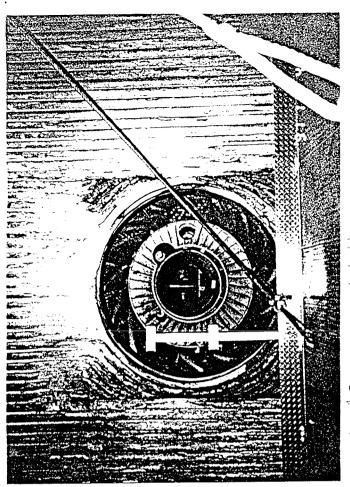

oto #Z: ROM Stabilizer



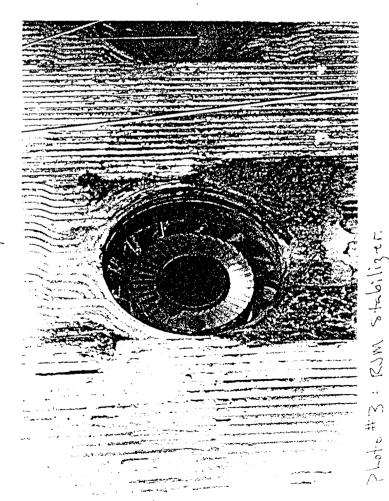

IP7\_004574


# IP7\_004575


#### INTERMOUNTAIN POWER SERVICE CORPORATION

Engineering Test and Inspection Sheet

Sheet <u>2</u> of <u>5</u>

Equipment Burners and Windbox Unit # 2 Test/Inspect. Date Oct. 27-28, 1991			
Inspector <u>Cecil Jame</u>	Inspector Cecil James Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations	
В3	1/2" hole in cone. Top: 3-1/8", Bottom: 6-1/2" Restrictor changed to 18" ID.	New diffuser 11/91	
В4	1-1/4" hole in cone. Top: 4-1/8", Bottom: 6-1/8"	New diffuser 11/91	
B5	1-1/2" hole in cone. Top: 4-1/8", Bottom: 6"	New diffuser 11/91	
В6	1/2" hole in cone. Top: 4-1/4", Bottom: 6-3/8"		
F1	1/8" hole in cone. Top: 5", Bottom: 7"		
F2	Outer register is warped, see photo 5. 3/8" hole in cone. Top: 5", Bottom: 7-1/4" Installed 20" ID restrictor.		
F3	1/4" hole in cone. Top: 3-1/2", Bottom: 6-1/4" Installed 20" ID restrictor.	New nozzle 11/91	
F4	Isolation valve will not close 100 percent. See photo 6. Spin vane (7:00 position) is bent. 3/8" hole in cone. Top: 3-3/4", Bottom: 6-3/8"	Valve repaired 11/91 Spin vane replaced 11/91 New nozzle 11/91	
F5	Spacer bar weld crack (10:00 position). Broken diffuser. Top: 4-1/4", Bottom: 6"	New nozzle 11/91 New diffuser 11/91	
F6	1/4" hole in cone. Top: 3-3/4", Bottom: 6"		
A1	3/8" hole in cone. Top: 3-1/8", Bottom: 6-1/4" Installed new 20" ID restrictor.	New diffuser 11/91	
A2	3/4" hole in cone. Top: 3-1/2", Bottom: 6-1/8" Restrictor changed to 18" ID.		
A3	Outer register vanes are seized up. Ceramic diffuser. Top: 8-5/8", Bottom: 8-3/4"		

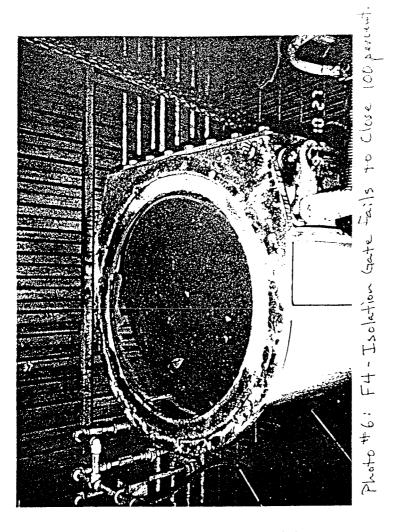

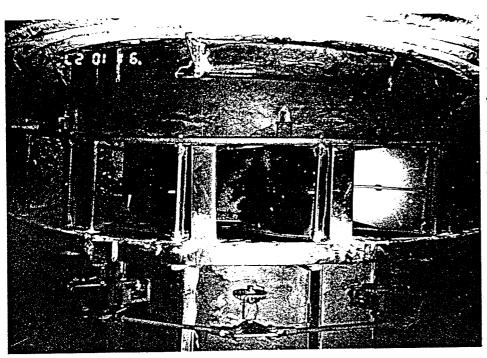

Photo#5: FZ Warped Outer Register.


# IP7\_004577

#### INTERMOUNTAIN POWER SERVICE CORPORATION

Engineering Test and Inspection Sheet

Sheet 3 of 5


Equipment Burners and Windbox Unit # 2 Test/Inspect. Date Oct. 27-28, 1991			
Inspector <u>Cecil J</u>	ames Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations	
A4	Spin vanes will not open 100%. 1/8" hole in cone. Top: 3-1/4", Bottom: 6-7/8" Installed new 20" ID restrictor Nozzle had split weld seam and holes at tip. See photo 7.	New nozzle 11/91	
A5	Ceramic diffuser. Top: 8-5/8", Bottom: 8-5/8"		
A6	1-3/8" hole in cone. Top: 1-1/2", Bottom: 4-7/8"	New diffuser 11/91	
E1	Broken cone. Top: 2-3/4", Bottom: 6-3/8". Installed new 20" ID restrictor.	New diffuser 11/91	
E2	Ceramic diffuser. Top: 8-5/8", Bottom: 8-5/8"		
E3	Outer register vanes are seized up. Ceramic diffuser. Top: 8-1/2", Bottom: 8-5/8" Restrictor changed to 19" ID.		
E4	Outer register vanes are seized up. 1/2" hole in cone. Top: 3-1/4", Bottom: 5-3/4" Restrictor changed to 18" ID.	New diffuser 11/91	
E5	1-1/4" hole in cone. Top: 2-1/8", Bottom: 5-5/8" Restrictor changed to 18-1/2" ID.	New diffuser 11/91 New nozzle 11/91	
E6	No hole. Top: 3-3/4", Bottom: 5-7/8" Restrictor changed to 17-1/2" ID. Hole in nozzle wall adjacent to diffuser. See photo 8.	New nozzle 11/91	
G1	2" hole in cone. Top: 3-1/2", Bottom: 7"	New diffuser 11/91	
G2	2-3/4" hole in cone. Top: 2", Bottom: 6-7/8"	New diffuser 11/91	
G3	1/2" hole in cone. Top: 3-3/4", Bottom: 6-1/4"		
G4	1/8" hole in cone. Top: 1-1/2", Bottom: 6-1/2"	New diffuser 11/91	
G5	1/8" hole in cone. Top: 3-3/4", Bottom: 6-7/8" Restrictor changed to 19" ID.		

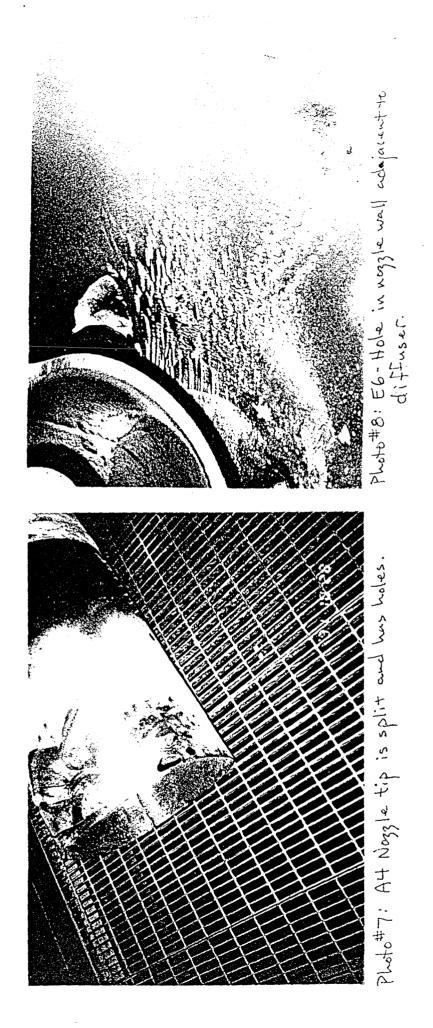

Engineering Test and Inspection Sheet

Sheet <u>4</u> of <u>5</u>

Equipment Burners and Windbox Unit # 2 Test/Inspect. Date Oct. 27-28, 1991			
Inspector <u>Cecil</u>	ector <u>Cecil James</u> Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations	
G6	Ceramic diffuser. Top: 8-5/8", Bottom: 8-5/8"		
C1	1-5/8" hole in cone. Top: 4-1/2", Bottom: 6-1/2"	New diffuser 11/91	
C2	Ceramic diffuser. Top: 8-1/2", Bottom: 8-3/4"		
C3	1/8" hole in cone. Top: 6-3/8", Bottom: 6-3/4"		
C4	3/8" hole in cone. Top: 4-1/4", Bottom: 6-3/4" Installed new 20" ID restrictor.	New nozzle 11/91	
C5	1/4" hole in cone. Top: 3-7/8", Bottom: 6" Installed new 20" ID restrictor.		
C6	Spin vanes are bound up. Broken diffuser. Top: 2-7/8", Bottom: 6" Nozzle wall at alloy weld joint bulged approximately 1/2". See photo 9.	New nozzle 11/91 New diffuser 11/91	
H pulverizer was c tips. See photo 1	os recieving new rotating throats. During which, conside.	derable ash accumulated in the nozzle	
н1	1" hole in cone. Top: 2-7/8", Bottom: 5" Installed new 20" restrictor.	New diffuser 11/91	
Н2	Broken ceramic diffuser. Top: 8-3/8", Bottom: ?	New diffuser 11/91	
нз	1-1/2" hole in cone. Top: 1-3/4", Bottom: 6-3/8" Installed new 20" restrictor.	New diffuser 11/91 New nozzle 11/91	
н4	1-1/4" hole in cone. Top: 4-1/4", Bottom: 5-1/2" Restrictor changed to 18" ID.	New diffuser 11/91 New nozzle 11/91	
н5	1-1/2" hole in cone. Top: 3", Bottom: 6" Restrictor changed to 17-1/2" ID.	New diffuser 11/91	
не	1" hole in cone. Top: 1-3/4", Bottom: 6-1/2" Restrictor changed to 17-1/2" ID.	New diffuser 11/91	
D1	Spin vane gears (12:00 position) not meshing. 1/2" hole in cone. Top: 3-1/4", Bottom: 6-3/4" Restrictor changed to 17" ID.	New diffuser 11/91	

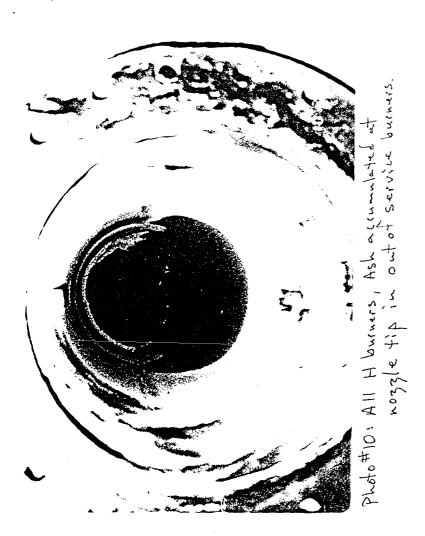

Plusto #9: Noggle wall


Engineering Test and Inspection Sheet

Sheet \_5 of \_5

Equipment Burners and Windbox Unit # 2 Test/Inspect. Date Oct. 27-28, 1991  Inspector Cecil James Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations
D2	3/4" hole in cone. Top: 4-1/2", Bottom: 5-1/2" Restrictor changed to 18" ID.	
D3	1/4" hole in cone. Top: 4-1/2", Bottom: 5-3/4" Restrictor changed to 18" ID.	
D4	Ceramic diffuser. Top: 8-1/2", Bottom: 8-5/8" Restrictor changed to 18-3/4" ID.	
D5	5/8" hole in cone. Top: 3-1/4", Bottom: 5-1/2" Installed new 20" ID restrictor.	New diffuser 11/91
D6	Spin vanes are bound up. Broken ceramic diffuser. Top: 8-1/2", Bottom: 8-5/8"	New nozzle 11/91 New diffuser 11/91

### UNIT 2 BURNER DIFFUSER MEASUREMENTS

Taken October, 1990 and October, 1991 Wear Monitoring

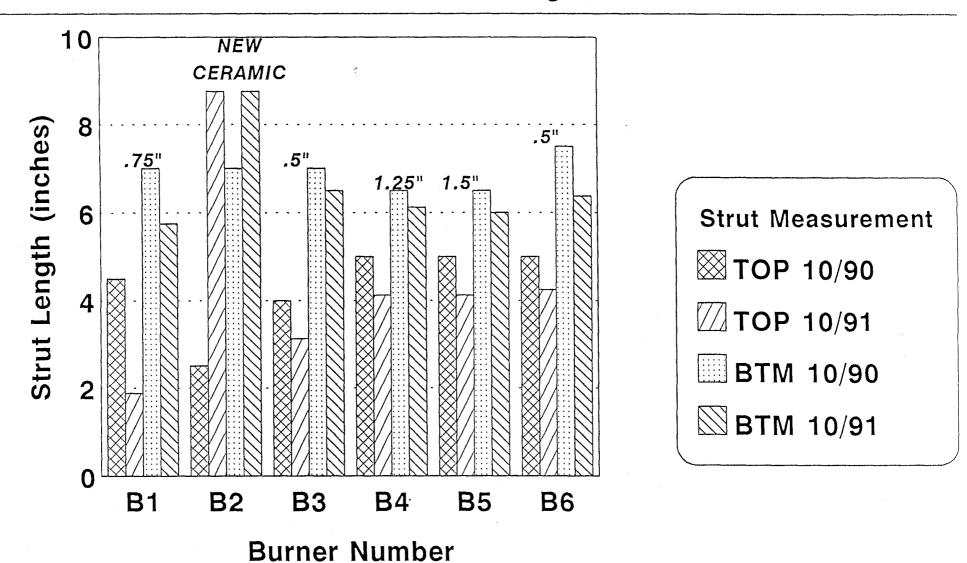

\*\*Numbers above bars indicate size of hole in cone

# IP7\_004583

#### INTERMOUNTAIN POWER SERVICE CORPORATION

Engineering Test and Inspection Sheet

Sheet <u>1</u> of <u>1</u>

Equipment <u>Burners</u> and	Windbox Unit # 1 Te	st/Inspect. Date <u>April 11, 1992</u>	
Inspector <u>Cecil James</u>	or <u>Cecil James</u> Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations	
Unit 1 burner work is	identified as capital project IGS91-3.		
burners have the fund  1. The outer regist 2. All burner parts 3. All burner parts 4. A second support 5. Linkages to the	re replaced with new B&W burners including new diffuser amental design features of the original burner design we have plate is segmented to allow movement as thermal are 309 stainless steel except the outer register from exposed to radiant heat was designed thicker to provide channel was added to the outer register back plate and outer register vanes and the inner air spin vanes are a	stresses rise.  t plate which is 304 stainless steel. e more rigidity. one to the outer register front plate. heavy duty (HD) type. The HD type	
6. A single angle b the outer regist 7. A second observa	the original burners were reliable and required little race from the top of the outer register back plate to ter back plate from deforming backwards. tion port was placed in the outer air zone. The scanne if flame detection could be improved.	he burner casing was installed to prevent	
See photos 1 - 6. Th	removed from the windboxes incurred extensive nozzle da ese burners never gave any indication of nozzle fires we ther burner components show little damage since the las	hile in service and the nozzles show	
Flyash Accumulation in Flyash accumulation i	Windbox n the B, A, G, and H windboxes appear greater than norm	al. See photos 7 and 8.	
the 100 percent open	gates were removed for burner work. Most gates failed position which resulted in gate and gate-seat wear, see seal when the gate was 100 percent closed, see photos 1	photos 9 and 10. The erosion on the gates	
Air flow tests on th	ere placed across the outer registers and back plates we inner and outer secondary air zones. Results show aiom burner to burner.	ere tuned in conjunction with data from flow improved to ±10 percent	

Engineering Test and Inspection Sheet

Sheet <u>2</u> of <u>2</u>

Equipment <u>Burner and</u>	Windbox Unit #	Test/Inspect. Date <u>April 11, 1992</u>	
Inspector <u>Cecil Jame</u>	nspector <u>Cecil James</u> Responsible Engineer (Initials)		
Item or Test	Observations/Comments	Recommendations	
23 restrictors were s photo 14. Since no o re-installed in it's	estrictors were scheduled for modification in an effort elected but only nine were completed. Asbestos gaskets he was prepared for an asbestos abatement procedure, th	were found in some restrictor joints, see	
Burner Line A1 A4 C4 C5 D1 D5 G4 G6 H3	Old Restrictor Size (ID inches) 21 21 21 21 17.5 21 18.38 18.38 21	New Restrictor Size (ID inches) 20 20 19 20 18 20 18 20 18 20	
All further restricto	work will be scheduled to coincide with future pulver	zer maintenance.	

IP7\_004584

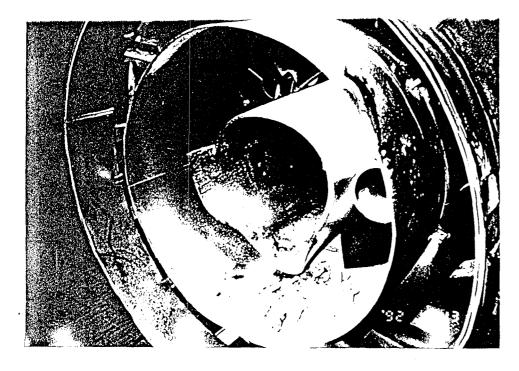


Photo 1: B Row Burner Deformation

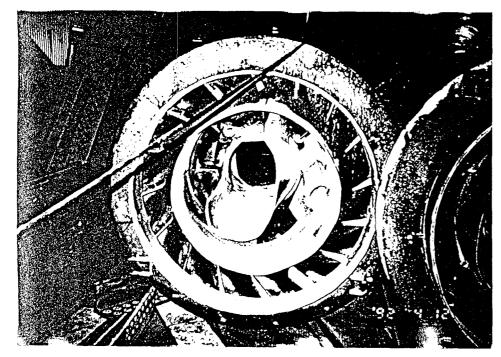


Photo 3: G Row Burner - Severe Nozzle Deformation Photo 4: G Row Burner - Severe Nozzle Deformation



Photo 2: G Row Burner - Severe Nozzle Deformation

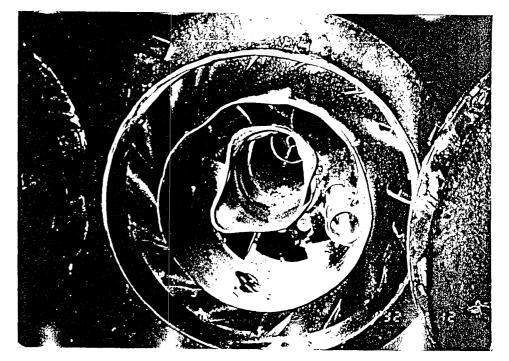




Photo 5: Severe Nozzle Deformation

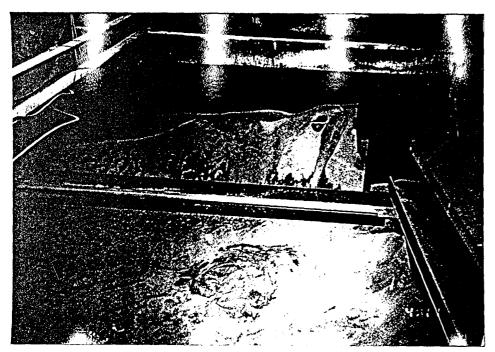


Photo 7: Flyash Accumulation - A Row



Photo 6: Severe Nozzle Deformation

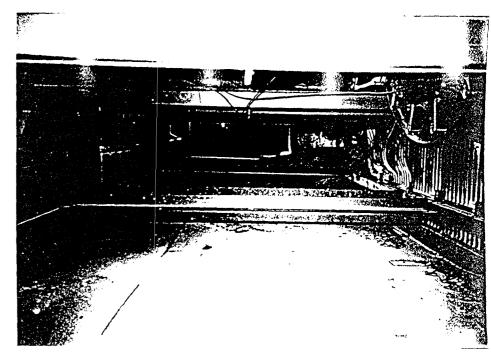


Photo 8: Flyash Accumulation - B Row

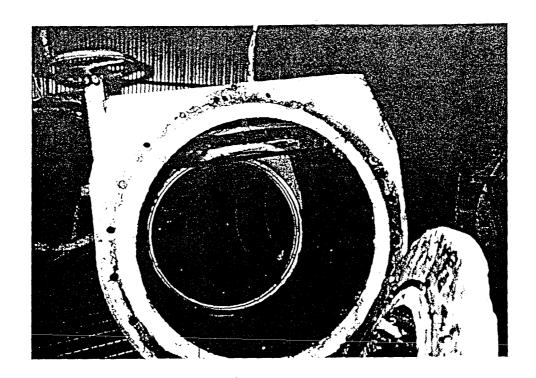


Photo 9: Isolation Valve - Gate Open But Still in Coal Path

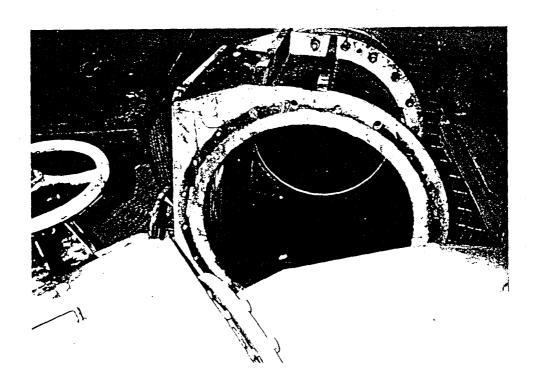


Photo 10: Isolation Valve - Gate Open But Still in Coal Path

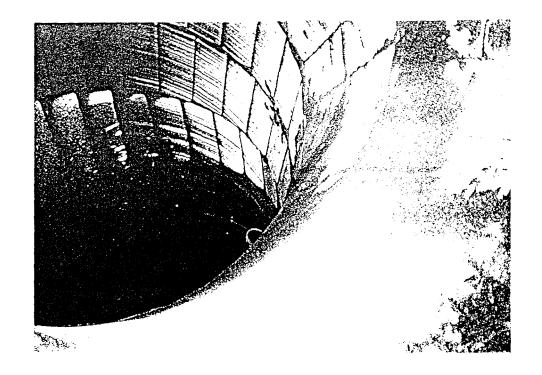


Photo 11: Isolation Valve - Gate Will Not Close Completely

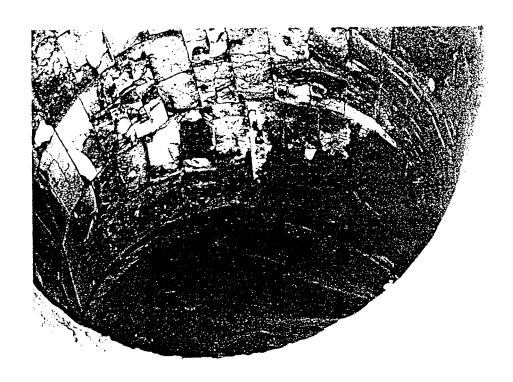


Photo 12: Isolation Valve - Gate Will Not Close Completely

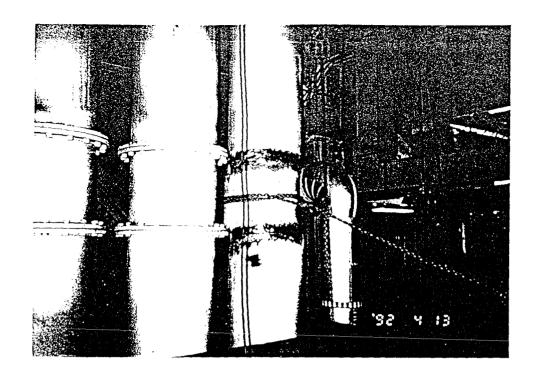


Photo 13: Al Restrictor Installation

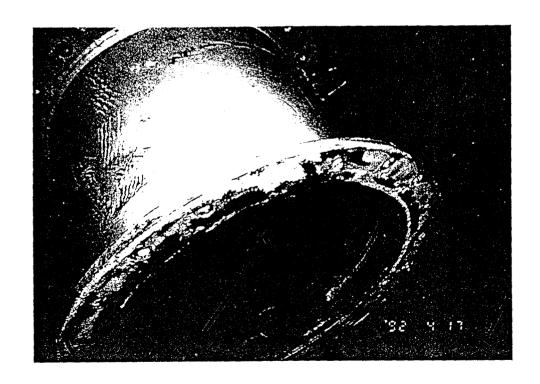


Photo 14: Asbestos Gasket - D4 Restrictor